


7-11000 Holiday Tradition Express set

Lockon Troubleshooting Guide

Symptom: The power indicator lamp is on, but none of the cars are lit and the engine does not respond.

Cause: No track power due to the lockon contacts not mating properly with the track contacts.

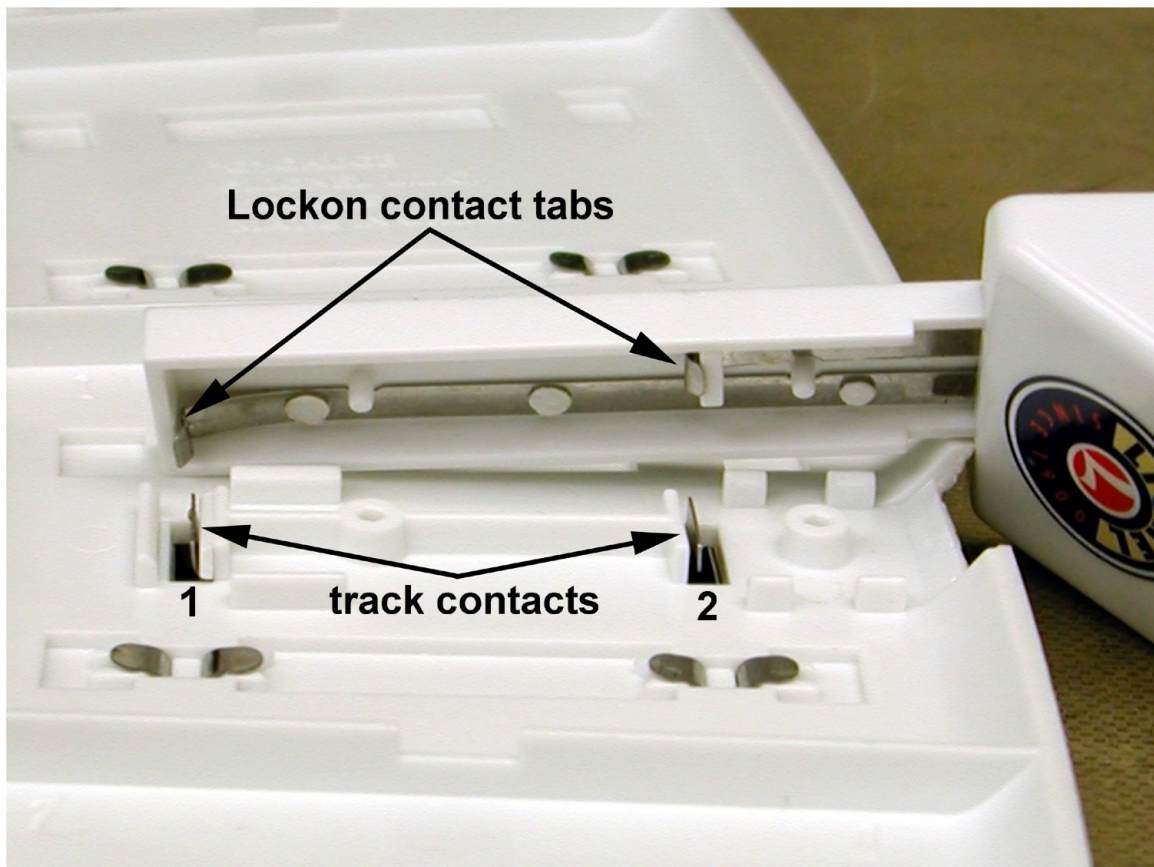

Solution: Using a small flat bladed screwdriver, bend track contacts (1) & (2) outward slightly, away from the plastic supports in the track. Several small adjustments to each contact may be needed to get the track tab to make contact with the lockon.

